BODY

SECTION RF ROOF

PRECAUTION2	System Description10
PRECAUTIONS2	CAN Communication System Description
Precaution for Supplemental Restraint System	Wiring Diagram - SROOF13 Terminal and Reference Value for BCM14
(SRS) "AIR BAG" and "SEAT BELT PRE-TEN-	Terminal and Reference Value for Sunroof Motor
SIONER"2	Assembly15
Precaution2	Work Flow15
	CONSULT-III Function (BCM)15
PREPARATION3	Work Support16
PREPARATION3	Active Test16
Commercial Service Tool	Data Monitor16
	Trouble Diagnosis Chart by Symptom16
SYMPTOM DIAGNOSIS4	BCM Power Supply and Ground Circuit Inspection
SQUEAK AND RATTLE TROUBLE DIAG-	16 16 Sunroof Switch System Inspection
	Sunroof Motor Assembly Power Supply and
NOSES	Ground Circuit Inspection
Generic Squeak and Rattle Troubleshooting	Door Switch Check
Diagnostic Worksheet	
-	ON-VEHICLE REPAIR21
FUNCTION DIAGNOSIS10	SUNROOF21
	Removal and Installation
TROUBLE DIAGNOSIS10	Fitting Adjustment
Component Parts and Harness Connector Loca- tion10	Inspection
10	

CONTENTS

Ν

А

В

С

D

Ε

F

G

Н

RF

J

Κ

L

Μ

0

< PRECAUTION >

PRECAUTION PRECAUTIONS

Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. This system includes seat belt switch inputs and dual stage front air bag modules. The SRS system uses the seat belt switches to determine the front air bag deployment, and may only deploy one front air bag, depending on the severity of a collision and whether the front occupants are belted or unbelted. Information necessary to service the system safely is included in the SR and SB section of this Service Manual.

WARNING:

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision which would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see the SR section.
- Do not use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

Precaution

INFOID:000000001704186

- Disconnect both battery cables in advance.
- Do not tamper with or force air bag lid open, as this may adversely affect air bag performance.
- Be careful not to scratch pad and other parts.
- When removing or disassembling any part, be careful not to damage or deform it. Protect parts which may get in the way with cloth.
- When removing parts with a screwdriver or other tool, protect parts by wrapping them with vinyl or tape.
- Keep removed parts protected with cloth.
- If a clip is deformed or damaged, replace it.
- If an unreusable part is removed, replace it with a new one.
- Tighten bolts and nuts firmly to the specified torque.
- After re-assembly has been completed, make sure each part functions correctly.
- Remove stains in the following way.

Water-soluble stains:

Dip a soft cloth in warm water, and then squeeze it tightly. After wiping the stain, wipe with a soft dry cloth. Oil stain:

Dissolve a synthetic detergent in warm water (density of 2 to 3% or less), dip the cloth, then clean off the stain with the cloth. Next, dip the cloth in fresh water and squeeze it tightly. Then clean off the detergent completely. Then wipe the area with a soft dry cloth.

• Do not use any organic solvent, such as thinner or benzine.

PREPARATION

< PREPARATION >	
PREPARATI	ON

PREPARATION

Commercial Service Tool

INFOID:000000001704187 B

А

Tool name		Description	
Engine ear		Locating the noise	I
	SIIA0995E		I

RF-3

Η

F

G

RF

J

L

Μ


Ν

Ο

< SYMPTOM DIAGNOSIS >

SYMPTOM DIAGNOSIS SQUEAK AND RATTLE TROUBLE DIAGNOSES

Work Flow

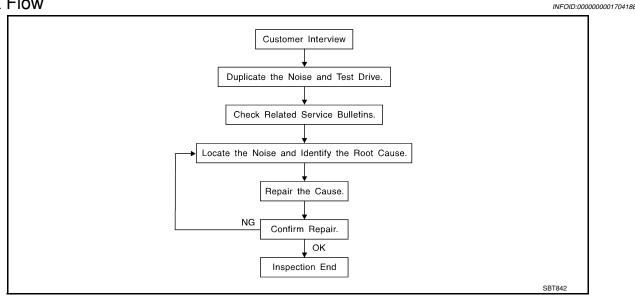

CUSTOMER INTERVIEW

Interview the customer if possible, to determine the conditions that exist when the noise occurs. Use the Diagnostic Worksheet during the interview to document the facts and conditions when the noise occurs and any customer's comments; refer to <u>IP-8</u>. "Diagnostic Worksheet". This information is necessary to duplicate the conditions that exist when the noise occurs.

- The customer may not be able to provide a detailed description or the location of the noise. Attempt to obtain all the facts and conditions that exist when the noise occurs (or does not occur).
- If there is more than one noise in the vehicle, be sure to diagnose and repair the noise that the customer is concerned about. This can be accomplished by test driving the vehicle with the customer.
- After identifying the type of noise, isolate the noise in terms of its characteristics. The noise characteristics are provided so the customer, service adviser and technician are all speaking the same language when defining the noise.
- Squeak —(Like tennis shoes on a clean floor)
 Squeak characteristics include the light contact/fast movement/brought on by road conditions/hard surfaces
 = higher pitch noise/softer surfaces = lower pitch noises/edge to surface = chirping
- Creak—(Like walking on an old wooden floor) Creak characteristics include firm contact/slow movement/twisting with a rotational movement/pitch dependent on materials/often brought on by activity.
- Rattle—(Like shaking a baby rattle) Rattle characteristics include the fast repeated contact/vibration or similar movement/loose parts/missing clip or fastener/incorrect clearance.
- Knock —(Like a knock on a door) Knock characteristics include hollow sounding/sometimes repeating/often brought on by driver action.
- Tick—(Like a clock second hand) Tick characteristics include gentle contacting of light materials/loose components/can be caused by driver action or road conditions.
- Thump—(Heavy, muffled knock noise)
 Thump characteristics include softer knock/dead sound often brought on by activity.
- Buzz—(Like a bumble bee) Buzz characteristics include high frequency rattle/firm contact.
- Often the degree of acceptable noise level will vary depending upon the person. A noise that you may judge as acceptable may be very irritating to the customer.
- Weather conditions, especially humidity and temperature, may have a great effect on noise level.

DUPLICATE THE NOISE AND TEST DRIVE

RF-4

< SYMPTOM DIAGNOSIS >

If possible, drive the vehicle with the customer until the noise is duplicated. Note any additional information on the Diagnostic Worksheet regarding the conditions or location of the noise. This information can be used to duplicate the same conditions when you confirm the repair.	A
If the noise can be duplicated easily during the test drive, to help identify the source of the noise, try to dupli- cate the noise with the vehicle stopped by doing one or all of the following: 1) Close a door.	В
 2) Tap or push/pull around the area where the noise appears to be coming from. 3) Rev the engine. 4) Use a floor jack to recreate vehicle "twist". 	С
 5) At idle, apply engine load (electrical load, half-clutch on M/T model, drive position on A/T model). 6) Raise the vehicle on a hoist and hit a tire with a rubber hammer. • Drive the vehicle and attempt to duplicate the conditions the customer states exist when the noise occurs. 	
 If it is difficult to duplicate the noise, drive the vehicle slowly on an undulating or rough road to stress the vehicle body. 	D
CHECK RELATED SERVICE BULLETINS After verifying the customer concern or symptom, check ASIST for Technical Service Bulletins (TSBs) related to that concern or symptom.	E
If a TSB relates to the symptom, follow the procedure to repair the noise.	F
LOCATE THE NOISE AND IDENTIFY THE ROOT CAUSE	
1. Narrow down the noise to a general area. To help pinpoint the source of the noise, use a listening tool (Engine Ear or mechanics stethoscope).	G
2. Narrow down the noise to a more specific area and identify the cause of the noise by:	
 removing the components in the area that you suspect the noise is coming from. Do not use too much force when removing clips and fasteners, otherwise clips and fastener can be broken or lost during the repair, resulting in the creation of new noise. 	Н
 tapping or pushing/pulling the component that you suspect is causing the noise. Do not tap or push/pull the component with excessive force, otherwise the noise will be eliminated only temporarily. 	RF
 feeling for a vibration with your hand by touching the component(s) that you suspect is (are) causing the noise. 	
 placing a piece of paper between components that you suspect are causing the noise. looking for loose components and contact marks. 	J
Refer to <u>RF-6. "Generic Squeak and Rattle Troubleshooting"</u> .	1Z
 REPAIR THE CAUSE If the cause is a loose component, tighten the component securely. 	Κ
 If the cause is insufficient clearance between components: 	
 separate components by repositioning or loosening and retightening the component, if possible. insulate components with a suitable insulator such as urethane pads, foam blocks, felt cloth tape or urethane tape are available through your authorized Nissan Parts Department. 	L
CAUTION: Do not use excessive force as many components are constructed of plastic and may be damaged. NOTE:	Μ
Always check with the Parts Department for the latest parts information. Each item can be ordered separately as needed. URETHANE PADS [1.5 mm (0.059 in) thick]	Ν
Insulates connectors, harness, etc.	
76268-9E005: $100 \times 135 \text{ mm} (3.94 \times 5.31 \text{ in})/76884-71L01: 60 \times 85 \text{ mm} (2.36 \times 3.35 \text{ in})/76884-71L02: 15 \times 25 \text{ mm} (0.59 \times 0.98 \text{ in})$ INSULATOR (Foam blocks)	0
Insulates components from contact. Can be used to fill space behind a panel. 73982-9E000: 45 mm (1.77 in) thick, 50×50 mm (1.97 × 1.97 in)/73982-50Y00: 10 mm (0.39 in) thick, 50 × 50 mm (1.97 × 1.97 in)	Ρ
INSULATOR (Light foam block)	
80845-71L00: 30 mm (1.18 in) thick, 30×50 mm (1.18 \times 1.97 in) FELT CLOTH TAPE	
Used to insulate where movement does not occur. Ideal for instrument panel applications. 68370-4B000: 15×25 mm (0.59 × 0.98 in) pad/68239-13E00: 5 mm (0.20 in) wide tape roll	

RF-5

< SYMPTOM DIAGNOSIS >

The following materials, not available through NISSAN Parts Department, can also be used to repair squeaks and rattles. UHMW(TEFLON) TAPE Insulates where slight movement is present. Ideal for instrument panel applications. SILICONE GREASE Used in place of UHMW tape that will be visible or not fit. Note: Will only last a few months. SILICONE SPRAY Use when grease cannot be applied. DUCT TAPE Use to eliminate movement. CONFIRM THE REPAIR

Confirm that the cause of a noise is repaired by test driving the vehicle. Operate the vehicle under the same conditions as when the noise originally occurred. Refer to the notes on the Diagnostic Worksheet.

Generic Squeak and Rattle Troubleshooting

INFOID:000000001704189

Refer to Table of Contents for specific component removal and installation information.

INSTRUMENT PANEL

Most incidents are caused by contact and movement between:

- 1. The cluster lid A and instrument panel
- 2. Acrylic lens and combination meter housing
- 3. Instrument panel to front pillar garnish
- 4. Instrument panel to windshield
- 5. Instrument panel pins
- 6. Wiring harnesses behind the combination meter
- 7. A/C defroster duct and duct joint

These incidents can usually be located by tapping or moving the components to duplicate the noise or by pressing on the components while driving to stop the noise. Most of these incidents can be repaired by applying felt cloth tape or silicone spray (in hard to reach areas). Urethane pads can be used to insulate wiring harness.

CAUTION:

Do not use silicone spray to isolate a squeak or rattle. If you saturate the area with silicone, you will not be able to recheck the repair.

CENTER CONSOLE

Components to pay attention to include:

- 1. Shifter assembly cover to finisher
- 2. A/C control unit and cluster lid C
- 3. Wiring harnesses behind audio and A/C control unit

The instrument panel repair and isolation procedures also apply to the center console.

DOORS

Pay attention to the:

- 1. Finisher and inner panel making a slapping noise
- 2. Inside handle escutcheon to door finisher
- 3. Wiring harnesses tapping
- 4. Door striker out of alignment causing a popping noise on starts and stops

Tapping or moving the components or pressing on them while driving to duplicate the conditions can isolate many of these incidents. You can usually insulate the areas with felt cloth tape or insulator foam blocks from the NISSAN Squeak and Rattle Kit (J-43980) to repair the noise.

TRUNK

Trunk noises are often caused by a loose jack or loose items put into the trunk by the owner. In addition look for:

1. Trunk lid bumpers out of adjustment

< SYMPTOM DIAGNOSIS >

 A A loose license plate or bracket Most of these incidents can be repaired by adjusting, securing or insulating the item(s) or component(s) causing the noise. SUNROOF/HEADLINING Noises in the sunroof/headlining area can often be traced to one of the following: Sunvisor shaft shaking in the holder Sun visor shaft shaking in the holder Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: Lose harness or harness connectors. Front console map/reading lamp lens loose. Lose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These and by include the onise word or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins 	_		
 A loss license plate or bracket Most of these incidents can be repaired by adjusting, securing or insulating the item(s) or component(s) causing the noise. SUNROOF/HEADLINING Noises in the sunroof/headlining area can often be traced to one of the following: Sunvoof lid, rail, linkage or seals making a rattle or light knocking noise Sun visor shaft shaking in the holder Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with field cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) OVERHEAD CONSOLE (FRONT AND REAR) OVerhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: Loose harness or harness connectors. Front console mapireading lamp lens loose. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder Aqueak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by components under the hood or on the engine wall. The noise is then transmitted underhood noise includes: Any component installed on the engine wall Components installed on the engine wall Components installed on the engine wall Component installed on	2	2. Trunk lid striker out of adjustment	
Most of these incidents can be repaired by adjusting, securing or insulating the item(s) or component(s) causing the noise. SUNROOF/HEADLINING Noises in the sunroof/headlining area can often be traced to one of the following: 1. Sunroof lid, rail, linkage or seals making a rattle or light knocking noise 2. Sun visor shaft shaking in the holder 3. Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: 1. Loose harness or harness connectors. 2. Front console map/reading lamp lens loose. 3. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. 3. Loose screws at console attachment points. SEATS When isolating seat noise include: 1. Headrest rods and holder 2. A squeak between the seat pad cushion and frame 3. The rear seatback lock and bracket UNDERHOCD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted underhood noise include: 1. Any component installed on the engine wall 3. Engine wall much the passenger compartment. Causes of transmitted underhood noise include: 1. Any component installed on the engine wall 3. Engine wall much that pass through the engine wall 3. Engine wall much that pass through the engine wall 3. Engine wall much shat pass through the engine wall 3. Engine wall much shat dousenctors 4. Loose radiator pins 5. Hood bumpers out of adju	3	3. The trunk lid torsion bars knocking together	А
ing the noise. SUNROOF/HEADLINING Noises in the sunroof/headlining area can often be traced to one of the following: 1. Sunroof lid, rail, linkage or seals making a rattle or light knocking noise 2. Sun visor shaft shaking in the holder 3. Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Survivation to look for: 1. Loose harness or harness connectors. 2. Front console map/reading lamp lens loose. 3. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. 3. Loose screws at noise include: 1. Headrest rods and holder 2. A squeak between the seat pad cushion and frame 3. The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the constant area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: 1. Any component installed on the engine wall 2. Component shat pass through the engine wall 3. Engine wall mounts and connectors 4. Loose radiator pins 5. Hood bumpers out of adjustment 6. Hood striker out of adjustment 7. Head ream in the robise include: 7. Hood bumpers out of adjustment 7. Head reams out of adjustment 7. Hood bumpers out of adjustment 7. Hood bumpers out of adjustment 7. Hood bumpers out of adjustmen	4	 A loose license plate or bracket 	
 Noises in the sunroof/headlining area can often be traced to one of the following: Sunroof lid, rail, linkage or seals making a rattle or light knocking noise Sun visor shaft shaking in the holder Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) OVERHEAD CONSOLE (FRONT and PREAR) Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: Loose harness or harness connectors. Front console map/reading lamp lens loose. Loose narness at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted in dherhood noise include: Any component installed on the engine wall Engine wall mounts and connectors Loose ardiator pins Hood bumpers out of adjustment Hood bumpers out of adjustment These noises can be difficult to isolate since they cannot be reached from the inte			В
 Sunroof lid, rail, linkage or seals making a rattle or light knocking noise Sun visor shaft shaking in the holder Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. Loose harness or harness connectors. Front console map/reading lamp lens loose. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the con- ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted underhood noise include: Any component installed on the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood bumpers out of adjustment Hood bumpers out of adjustment Hood bumpers o	S	SUNROOF/HEADLINING	
 Sunroof lid, rail, linkage or seals making a rattle or light knocking noise Sun visor shaft shaking in the holder Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Overhead console noises are othen caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: Loose harness or harness connectors. Front console map/reading lamp lens loose. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted in the passenger compartment. Causes of transmitted nuclerhood noise include: Any component installed on the engine wall	1	Noises in the sunroof/headlining area can often be traced to one of the following:	С
 Front or rear windshield touching headliner and squeaking Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: Loose harness or harness connectors. Front console map/reading lamp lens loose. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the con- ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Components that pass through the engine wall Engine wall mounts and connector	-	 Sunroof lid, rail, linkage or seals making a rattle or light knocking noise 	0
Again, pressing on the components to stop the noise while duplicating the conditions can isolate most of these incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: Loose harness or harness connectors. Front console map/reading lamp lens loose. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. A squeak between the seat pad cushion and frame These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Components that pass through the engine wall Loose radiator pins Repaired at the engine wall to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or loo dardiate the noise Repaire Repaired by making the reace.	2	2. Sun visor shaft shaking in the holder	
Incidents. Repairs usually consist of insulating with felt cloth tape. OVERHEAD CONSOLE (FRONT AND REAR) Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: Loose harness or harness connectors. Front console map/reading lamp lens loose. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Components that pass through the engine wall Components that pass through the engine wall Loose transmitted underhood noise include: Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment Cheod striker out of adjustment Cheod striker out of adjustment Cheod and be cheod end component at a time and test drive the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or	3	Front or rear windshield touching headliner and squeaking	D
Overhead console noises are often caused by the console panel clips not being engaged correctly. Most of these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: 1. Loose harness or harness connectors. 2. Front console map/reading lamp lens loose. 3. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. 2. A squeak between the seat pad cushion and frame 3. The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the con- ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted underhood noise include: 1. Any component installed on the engine wall 2. Components that pass through the engine wall 3. Engine wall mounts and connectors 4. Loose radiator pins 5. Hood surpress out of adjustment 6. Hood striker out of adjustment 7. These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or			
these incidents are repaired by pushing up on the console at the clip locations until the clips engage. In addition look for: 1. Loose harness or harness connectors. 2. Front console map/reading lamp lens loose. 3. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: 1. Headrest rods and holder 2. A squeak between the seat pad cushion and frame 3. The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the con- ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted underhood noise include: 1. Any component installed on the engine wall 2. Components that pass through the engine wall 3. Engine wall mounts and connectors 4. Loose radiator pins 5. Hood bumpers out of adjustment 6. Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Cause an usually be made by moving, adjusting, securing, or	(OVERHEAD CONSOLE (FRONT AND REAR)	Е
 Loose harness or harness connectors. Front console map/reading lamp lens loose. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: I Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or	t	hese incidents are repaired by pushing up on the console at the clip locations until the clips engage.	
 2. Front console map/reading lamp lens loose. 3. Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted on the engine wall Component installed on the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	I		F
 Loose screws at console attachment points. SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Components that pass through the engine wall Loose radiator pins Hood bumpers out of adjustment Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 			
 SEATS When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 			\sim
 When isolating seat noise it's important to note the position the seat is in and the load placed on the seat when the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or			G
 the noise is present. These conditions should be duplicated when verifying and isolating the cause of the noise. Cause of seat noise include: Headrest rods and holder A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 			
Cause of seat noise include: 1. Headrest rods and holder 2. A squeak between the seat pad cushion and frame 3. The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the con- ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: 1. Any component installed on the engine wall 2. Components that pass through the engine wall 3. Engine wall mounts and connectors 4. Loose radiator pins 5. Hood bumpers out of adjustment 6. Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or	t	he noise is present. These conditions should be duplicated when verifying and isolating the cause of the	Η
 A squeak between the seat pad cushion and frame The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 			
 The rear seatback lock and bracket These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	-	I. Headrest rods and holder	RF
 These noises can be isolated by moving or pressing on the suspected components while duplicating the conditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	2	2. A squeak between the seat pad cushion and frame	
 ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component or applying urethane tape to the contact area. UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: Any component installed on the engine wall Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	3	3. The rear seatback lock and bracket	1
 UNDERHOOD Some interior noise may be caused by components under the hood or on the engine wall. The noise is then transmitted into the passenger compartment. Causes of transmitted underhood noise include: 1. Any component installed on the engine wall 2. Components that pass through the engine wall 3. Engine wall mounts and connectors 4. Loose radiator pins 5. Hood bumpers out of adjustment 6. Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	C	ditions under which the noise occurs. Most of these incidents can be repaired by repositioning the component	0
 transmitted into the passenger compartment. Causes of transmitted underhood noise include: 1. Any component installed on the engine wall 2. Components that pass through the engine wall 3. Engine wall mounts and connectors 4. Loose radiator pins 5. Hood bumpers out of adjustment 6. Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	ι	JNDERHOOD	K
 Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment Hose noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	t	ransmitted into the passenger compartment.	L
 Components that pass through the engine wall Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment Hose noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	-	1. Any component installed on the engine wall	
 Engine wall mounts and connectors Loose radiator pins Hood bumpers out of adjustment Hood striker out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	2		ь л
 Hood bumpers out of adjustment Hood striker out of adjustment Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or 	3	3. Engine wall mounts and connectors	Μ
6. Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or	2	4. Loose radiator pins	
6. Hood striker out of adjustment These noises can be difficult to isolate since they cannot be reached from the interior of the vehicle. The best method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or	Ę		Ν
method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or	6	5. Hood striker out of adjustment	
	r c	method is to secure, move or insulate one component at a time and test drive the vehicle. Also, engine RPM or load can be changed to isolate the noise. Repairs can usually be made by moving, adjusting, securing, or	0

< SYMPTOM DIAGNOSIS >

Diagnostic Worksheet

INFOID:000000001704190


Dear Customer:

 
We are concerned about your satisfaction with your vehicle. Repairing a squeak or rattle sometimes can be very difficult. To help us fix your vehicle right the first time, please take a moment to note the area of the vehicle where the squeak or rattle occurs and under what conditions. You may be asked to take a test drive with a service advisor or technician to ensure we confirm the noise you are hearing.


SQUEAK & RATTLE DIAGNOSTIC WORKSHEET

I. WHERE DOES THE NOISE COME FROM? (circle the area of the vehicle)

The illustrations are for reference only, and may not reflect the actual configuration of your vehicle.

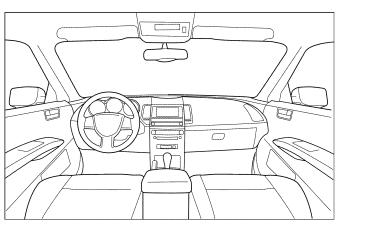



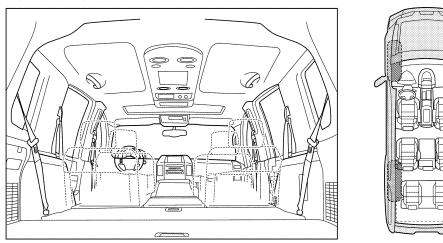

Continue to page 2 of the worksheet and briefly describe the location of the noise or rattle. In addition, please indicate the conditions which are present when the noise occurs.

LAIA0072E

< SYMPTOM DIAGNOSIS >


Briefly describe the location where the no	ise occurs:			
I. WHEN DOES IT OCCUR? (please ch	eck the box	es that app	oly)	
Anytime	🛛 Aft	er sitting ou	ut in the rai	'n
☐ 1st time in the morning		nen it is rair		
Only when it is cold outside	🗌 Dry	y or dusty c	onditions	
Only when it is hot outside	🗌 Otl	her:		
III. WHEN DRIVING:	IV. WI	HAT TYPE	OF NOISE	:
Through driveways	🔲 Sq	ueak (like t	ennis shoe	s on a clean floor)
Over rough roads			-	n old wooden floor)
Over speed bumps		ttle (like sha	-	-
Only about mph		ock (like a l		•
 On acceleration Coming to a stop 	_	k (like a clo ump (heavy		
☐ On turns: left, right or either (circle)		zz (like a bu		
☐ With passengers or cargo				
Uther:				
☐ Other: ☐ After driving miles or mir	nutes			
After driving miles or mir		EL		
After driving miles or mir		EL		
		EL	NO	Initials of person performing
After driving miles or mir			NO	Initials of person performing
After driving miles or mir TO BE COMPLETED BY DEALERSHIP Test Drive Notes: /ehicle test driven with customer			NO	Initials of person performing
After driving miles or mir TO BE COMPLETED BY DEALERSHIP Test Drive Notes: /ehicle test driven with customer - Noise verified on test drive			NO	performing
After driving miles or mir TO BE COMPLETED BY DEALERSHIP Test Drive Notes: Vehicle test driven with customer - Noise verified on test drive - Noise source located and repaired	PERSONNI		NO	performing
After driving miles or mir TO BE COMPLETED BY DEALERSHIP Test Drive Notes:	PERSONNI	YES		performing

< FUNCTION DIAGNOSIS >

FUNCTION DIAGNOSIS TROUBLE DIAGNOSIS

Component Parts and Harness Connector Location

INFOID:000000001704191

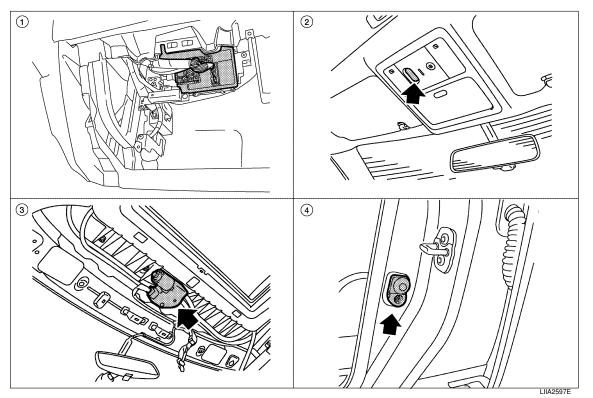

- 1. BCM M18, M19, M20 (view with glove 2. Sunroof switch R6 box removed)
- 4. Front door switch LH B8, RH B108

System Description

OUTLINE

Electric sunroof system consists of

- Sunroof switch
- Sunroof motor assembly
- BCM (body control module)

BCM supplies power to the sunroof motor. Sunroof operation depends on sunroof switch condition.

OPERATION

Power is supplied at all times

- through 40A fusible link (letter g , located in the fuse and fusible link box)
- to BCM terminal 70, and
- through BCM terminal 69
- to sunroof motor assembly terminal 7.

When the ignition switch is in the ON or START position, power is supplied

- through 10A fuse [No. 6, located in the fuse block (J/B)]
- to BCM terminal 38, and
- through BCM terminal 68
- to sunroof motor assembly terminal 9.
- Ground is supplied
- to BCM terminal 67
- through grounds M57 and M61.

TILT UP/SLIDE CLOSE OPERATION When up/close switch is pressed, ground is supplied

RF-10

3. Sunroof motor assembly R4

INFOID:000000001704192

< FUNCTION DIAGNOSIS >	
 to sunroof motor assembly terminal 1 through sunroof switch terminal 3 through sunroof switch terminal 2 through grounds M57 and M61. Then the sunroof will tilt up/slide closed. 	A
TILT DOWN/SLIDE OPEN OPERATION	В
 When down/open switch is pressed, ground is supplied to sunroof motor assembly terminal 5 through sunroof switch terminal 1 through sunroof switch terminal 2 through grounds M57 and M61. Then the sunroof will tilt down/slide open. 	C
AUTO OPERATION	
The power sunroof AUTO feature makes it possible to slide open and slide closed or tilt up and tilt down the sunroof without holding the sunroof switch in the UP/CLOSE or DOWN/OPEN position.	E
 RETAINED POWER OPERATION When the ignition switch is turned to OFF position from ON position, power is supplied for 45 seconds through BCM terminal 68 to sunroof motor assembly terminal 9. When power is supplied, the sunroof can be operated. The retained power operation is canceled when the front door LH or RH is opened. 	F
RAP signal period can be changed by CONSULT-III. Refer to <u>RF-16. "Work Support"</u> .	
ANTI-PINCH FUNCTION The CPU (central processing unit) of sunroof motor assembly monitors the sunroof motor operation and the sunroof position (fully-closed or other) by the signals from sunroof motor. When sunroof motor detects an interruption during the following slide close and tilt down operation, sunroof	Н
awitch controls the motor for energy and the suproof will energies with it reaches full up position (during tilt down	RF
INITIALIZATION FAILURE CONDITIONS	J
 Initialization and teaching of system should be conducted if the following conditions exist: sunroof will only move in the UP/CLOSE direction, having a step by step motion sunroof does not have any auto operation. 	K
INITIALIZATION PROCEDURE	
If the sunroof does not close or open automatically, use the following procedure to return sunroof operation to normal.	L
 Press the switch to the UP/CLOSE position to tilt the sunroof up fully. When the sunroof reaches the full tilt up position it will back up a few millimeters and stop. Release the UP/CLOSE switch. 	M
 Within 5 seconds of releasing the UP/CLOSE switch, press and hold the UP/CLOSE switch again. The 	
sunroof will move to the full open position and back to the closed position.	
NOTE:	Ν
If the UP/CLOSE switch is released anytime during this teaching process, all learned profile data will be dis- carded and the procedure will have to be started over.	
4. Release the UP/CLOSE switch. Do not disconnect power for at least two seconds. The sunroof is now ini- tialized and taught.	0
Initializing procedure is complete. Confirm proper operation of the sunroof (slide open, slide closed, tilt up, tilt down).	Ρ
 RE-TEACHING CONDITIONS Re-teaching of system should be conducted if any of the following conditions exist: the sunroof is manually operated using the sunroof wrench with the battery discharged or disconnected. the sunroof is manually operated using the sunroof wrench with the key switch in the OFF position and retained power timed out (after approximately 45 seconds or with a front door open). 	

- the sunroof motor is removed from the sunroof assembly and operated before it is reinstalled.

< FUNCTION DIAGNOSIS >

• the sunroof motor is removed from the sunroof assembly and the glass panel position is changed.

RE-TEACHING PROCEDURE

- 1. Using the UP/CLOSE switch, move the sunroof toward the tilt position until it stops.
- 2. Release the UP/CLOSE switch.
- 3. Press the UP/CLOSE switch again and continuously hold. The sunroof will begin to move in about 10 seconds.
- 4. Continue to hold the UP/CLOSE switch while the sunroof moves in a jogging motion to the full tilt position. When the sunroof reaches the full tilt position, it will back up a few millimeters and stop.
- 5. Release the UP/CLOSE switch.
- 6. Within 5 seconds of releasing the UP/CLOSE switch, press and hold the UP/CLOSE switch again. The sunroof will move to the full open position and back to the closed position.

NOTE:

If the UP/CLOSE switch is released anytime during this teaching process, all learned profile data will be discarded and the procedure will have to be started over.

7. Release the UP/CLOSE switch. Do not disconnect power for at least two seconds. The sunroof is now retaught.


CAN Communication System Description

INFOID:000000001704193


Refer to LAN-6.

< FUNCTION DIAGNOSIS >

Wiring Diagram - SROOF -

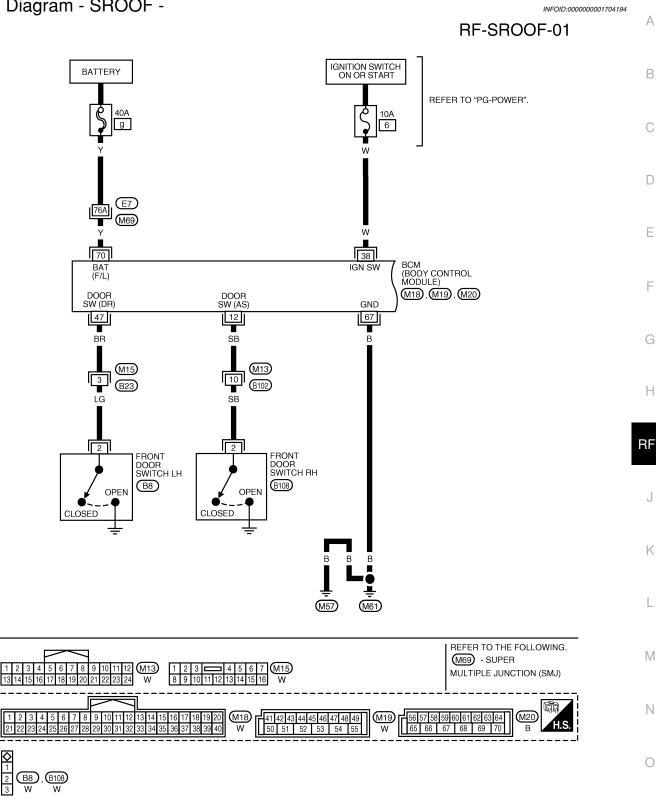

WIWA1950E

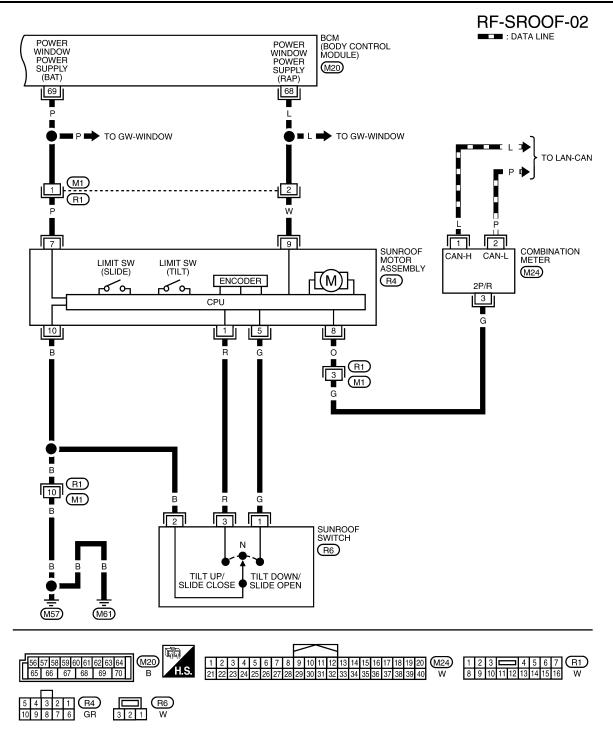

Terminal and Reference Value for BCM

Refer to BCS-11, "Terminal and Reference Value for BCM" .

WIWA1951E

INFOID:000000001704195

< FUNCTION DIAGNOSIS >

Terminal and Reference Value for Sunroof Motor Assembly

INFOID:000000001704196

INFOID:000000001704197

INFOID:000000001704198

Κ

L

Μ

А

erminal	Wire col- or	ltem	Condition	Voltage (Approx.)
1	R	Sunroof switch (UP/CLOSE) signal	Ignition switch ON and sunroof switch in UP/CLOSE position	0
I	n	Sunrooi switch (UF/GLOSE) signal	Ignition switch ON and sunroof switch in OFF position	Battery voltage
5	G	Sunroof switch (DOWN/OPEN) signal	Ignition switch ON and sunroof switch in DOWN/OPEN position	0
5	u		Ignition switch ON and sunroof switch in OFF position	Battery voltage
7	Р	BAT power supply	_	Battery voltage
8	0	Vehicle speed signal	Speedometer operated [when ve- hicle speed is approx. 40 km/h (25 MPH)]	(V) 6 4 2 0 • • • • 50ms ELF1080D
			Ignition switch ON	Battery voltage
9	W	RAP signal	Within 45 seconds after ignition switch is turned OFF	Battery voltage
-			When front door LH or RH is opened while retained power is operating	0
10	В	Ground	_	0

Work Flow

- 1. Check the symptom and customer's requests.
- 2. Understand the outline of system. Refer to RF-10. "System Description" .
- 3. According to the trouble diagnosis chart, repair or replace the cause of the malfunction. Refer to <u>RF-16, "Trouble Diagnosis Chart by Symptom"</u>.
- 4. Does sunroof system operate normally? If Yes, GO TO 5. If No, GO TO 3.
- 5. Inspection End.

CONSULT-III Function (BCM)

CONSULT-III can display each diagnostic item using the diagnostic test modes shown following.

BCM diagnostic test item	Diagnostic mode	Description	Ν
	WORK SUPPORT	Supports inspections and adjustments. Commands are transmitted to the BCM for setting the status suitable for required operation, input/output signals are received from the BCM and received data is displayed.	0
	DATA MONITOR	Displays BCM input/output data in real time.	
Inspection by part	ACTIVE TEST	Operation of electrical loads can be checked by sending drive signal to them.	D
-p, p	SELF-DIAG RESULTS	Displays BCM self-diagnosis results.	Г
	CAN DIAG SUPPORT MNTR	The result of transmit/receive diagnosis of CAN communication can be read.	
	ECU PART NUMBER	BCM part number can be read.	
	CONFIGURATION	Performs BCM configuration read/write functions.	

< FUNCTION DIAGNOSIS >

Work Support

INFOID:000000001704199

Work item	Description
RETAINED PWR SET	 RAP signal's power supply period can be changed by mode setting. Selects RAP signal's power supply period between the following three steps. MODE 1 (45 sec.) / MODE 2 (OFF) / MODE 3 (2 min.)

Active Test

INFOID:000000001704200

Test item	Description
RETAINED PWR	This test is able to supply RAP signal (power) from BCM to power window system, power sunroof system. Those systems can be operated when turning on "RETAINED PWR" on CONSULT-III screen even if the ignition switch is turned OFF. NOTE: During this test, CONSULT-III can be operated with ignition switch in "OFF" po- sition. "RETAINED PWR" should be turned "ON" or "OFF" on CONSULT-III screen when ignition switch ON. Then turn ignition switch OFF for checking re- tained power operation. CONSULT-III might be stuck if "RETAINED PWR" is turned "ON" or "OFF" on CONSULT-III screen when ignition switch is OFF.

Data Monitor

INFOID:000000001704201

Monitored item	Description
IGN ON SW	Indicates [ON/OFF] condition of ignition switch.
DOOR SW-DR	Indicates [ON/OFF] condition of front door switch LH.
DOOR SW-AS	Indicates [ON/OFF] condition of front door switch RH.

Trouble Diagnosis Chart by Symptom

INFOID:000000001704202

Symptom	Diagnostic procedure and repair order	Refer to page
	1. BCM power supply and ground circuit check	<u>BCS-15</u>
Sunroof does not operate.	2. Sunroof motor assembly power supply and ground circuit check	<u>RF-18</u>
	3. Sunroof switch system check	<u>RF-16</u>
	4. Replace sunroof motor assembly	<u>RF-21</u>
Motor does not stop at the sunroof fully-open or fully-closed	1. Initialization procedure check	<u>RF-10</u>
position.	2. Replace sunroof motor assembly	<u>RF-21</u>
Retained power operation does not operate properly.	1. Check the retained power operation mode setting	<u>RF-10</u>
	2. BCM power supply and ground circuit check	BCS-15
	3. Door switch check	<u>RF-19</u>
	4. Replace sunroof motor assembly	<u>RF-21</u>
Sunroof does not do the interruption detection.	1. Replace sunroof motor assembly	<u>RF-21</u>

BCM Power Supply and Ground Circuit Inspection

Refer to BCS-15, "BCM Power Supply and Ground Circuit Inspection" .

Sunroof Switch System Inspection

1.SUNROOF SWITCH INPUT SIGNAL CHECK

INFOID:000000001704204

INFOID:000000001704203

Voltage

(Approx.)

0

Battery voltage

0

Battery voltage

< FUNCTION DIAGNOSIS >

(+)

1

5

- 1. Turn ignition switch ON.
- 2. Check voltage between sunroof motor assembly connector and ground.

Condition

Sunroof switch is operated


Sunroof switch is operated

to UP/CLOSE

Other than above

to DOWN/OPEN

Other than above

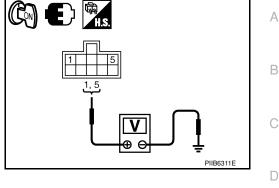

1.5

Е

F

Н

RF

Κ

Ρ

в

1.3

PIIB6312E

OK or NG

R4

Connector

- OK >> Sunroof switch input signal circuits are OK.
- NG >> GO TO 2.
- 2.SUNROOF SWITCH CIRCUIT CHECK

Terminal

(-)

Ground

- 1. Turn ignition switch OFF.
- 2. Disconnect sunroof motor assembly and sunroof switch.
- Check continuity between sunroof motor assembly connector R4 (A) terminals 1, 5 and sunroof switch connector R6 (B) terminals 1, 3.
 - 1 3
 - 5 1

: Continuity should exist.

: Continuity should exist.

- Check continuity between sunroof motor assembly connector R4 (A) terminals 1, 5 and ground.
 - 1 Ground 5 - Ground

: Continuity should not exist. : Continuity should not exist.

- OK or NG
- OK >> GO TO 3.
- NG >> Repair or replace harness.


${f 3.}$ SUNROOF SWITCH GROUND CIRCUIT CHECK

Check continuity between sunroof switch connector R6 terminal 2 and ground.

2 - Ground

: Continuity should exist.

- <u>OK or NG</u>
- OK >> GO TO 4.
- NG >> Repair or replace harness.

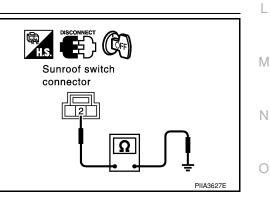


Ω

4.SUNROOF SWITCH CHECK

< FUNCTION DIAGNOSIS >

Check continuity between sunroof switch terminals 1, 3 and 2.

Terminals		Condition	Continuity
1		Sunroof switch is operated to DOWN/OPEN	Yes
	2	Other than above	No
3		Sunroof switch is operated to UP/CLOSE	Yes
		Other than above	No

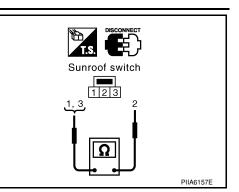

E) 🕅

9

C E :

OK or NG

OK >> Replace sunroof motor assembly. Refer to RF-21, "Removal and Installation" .

NG >> Replace sunroof switch.

Sunroof Motor Assembly Power Supply and Ground Circuit Inspection

: Battery voltage

: Battery voltage

INFOID:000000001704205

PIIB6300E

PIIB6301E

1.CHECK POWER SUPPLY CIRCUIT

- 1. Turn ignition switch ON.
- Check voltage between sunroof motor assembly connector R4 2. terminals 7, 9 and ground.
 - 7 Ground
 - 9 Ground

OK or NG

OK >> GO TO 2. NG >> GO TO 3.

2.CHECK GROUND CIRCUIT

- 1. Turn ignition switch OFF.
- Disconnect sunroof motor assembly. 2.
- Check continuity between sunroof motor assembly connector 3. R4 terminal 10 and ground.

10 - Ground : Continuity should exist.

OK or NG

- OK >> Sunroof motor assembly power supply and ground circuits are OK. Further inspection is necessary. Refer to RF-16, "Trouble Diagnosis Chart by Symptom"
- NG >> Repair or replace harness.
- ${f 3.}$ CHECK BCM OUTPUT SIGNAL

Check voltage between BCM connector M20 terminals 68, 69 and ground.


- 68 Ground
- : Battery voltage
- 69 Ground

- : Battery voltage

- OK or NG

OK >> GO TO 4. >> Replace BCM. Refer to BCS-18, "Removal and Installa-NG tion of BCM".

4.CHECK SUNROOF MOTOR CIRCUIT

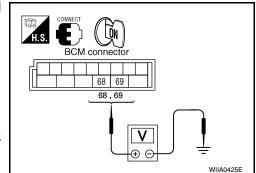

< FUNCTION DIAGNOSIS >

- 1. Turn ignition switch OFF.
- 2. Disconnect BCM and sunroof motor assembly connectors.
- 3. Check continuity between BCM connector M20 (A) terminals 68, 69 and sunroof motor assembly connector R4 (B) terminals 7, 9.
 - 68 9 : Continuity should exist. 69 - 7 : Continuity should exist.
- 4. Check continuity between BCM connector M20 (A) terminals 68, 69 and ground.
 - 68 Ground 69 - Ground
- : Continuity should not exist.
- : Continuity should not exist.

OK or NG

>> Sunroof motor assembly power supply circuits are OK. Further inspection is necessary. Refer to OK RF-16, "Trouble Diagnosis Chart by Symptom" NG

RF-19

>> Repair or replace harness.

Door Switch Check

1. CHECK DOOR SWITCH INPUT SIGNAL

With CONSULT-III


Check ("DOOR SW-DR" and "DOOR SW-AS") in "DATA MONITOR" mode with CONSULT-III.

Monitor item	Condition	
DOOR SW-DR	DOOR OPEN	: ON
DOOR SW-DR	DOOR CLOSED	: OFF
DOOR SW-AS	DOOR OPEN	: ON
DOON SW-AS	DOOR CLOSED	: OFF

Without CONSULT-III

Check voltage between BCM connector M18, M19 terminals 12, 47 and ground.

Item	Terminal		Condition	Voltage	
item	(+)	(-)	Condition	(Approx.)	
Front door	12		DOOR OPEN (Switch closed)	0	
switch RH	12	Ground	DOOR CLOSED (Switch open)	Battery voltage	
Front door switch LH	47	Ground	DOOR OPEN (Switch closed)	0	
	47		DOOR CLOSED (Switch open)	Battery voltage	

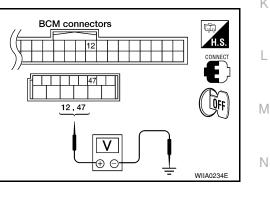


OK or NG

OK >> Door switch circuit is OK.

NG >> GO TO 2.

2. CHECK DOOR SWITCH CIRCUIT

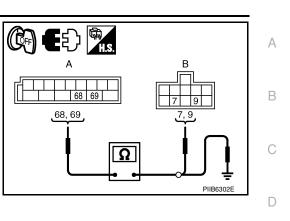

Н

Ε

F

INFOID:000000001704206

RF



< FUNCTION DIAGNOSIS >

- 1. Turn ignition switch OFF.
- 2. Disconnect door switch and BCM.
- 3. Check continuity between BCM connector M18, M19 terminals 12, 47 and door switch connectors B8, B108 terminal 2.

Front door LH	
47 - 2	: Continuity should exist.
Front door RH	
12 - 2	: Continuity should exist.


4. Check continuity between BCM connector M18, M19 terminals 12, 47 and ground.

: Continuity should not exist.

: Continuity should not exist.

47 - Ground

- <u>OK or NG</u>
- OK >> GO TO 3.
- NG >> Repair or replace harness.

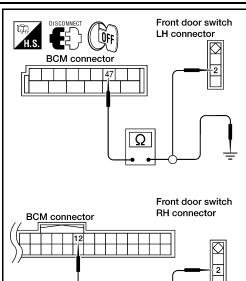

3. CHECK DOOR SWITCH

Check continuity between door switches terminal 2 and ground part of door switch.

Terminal		Door switch	Continuity
2	Ground part of	Pushed	No
2	door switch	Released	Yes


OK or NG

OK >> GO TO 4.

NG >> Replace malfunctioning door switch.


4. CHECK BCM OUTPUT SIGNAL

- 1. Connect BCM.
- Check voltage between BCM connector M18, M19 terminals 12, 47 and ground.
 - 12 Ground
- : Battery voltage : Battery voltage
- 47 Ground
- OK or NG
- OK >> Further inspection is necessary. Refer to <u>RF-16</u>, "Trouble Diagnosis Chart by Symptom".
- NG >> Replace BCM. Refer to <u>BCS-18</u>, "Removal and Installation of BCM".

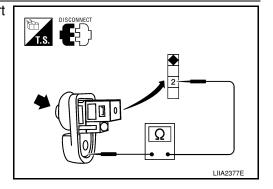

Ω

WIIA0626E

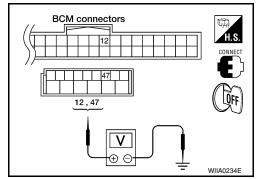

< ON-VEHICLE REPAIR >

ON-VEHICLE REPAIR SUNROOF

Removal and Installation

INFOID:000000001704207 B

А

С

D

Е

F

CAUTION:

- After installation or any adjustment, check clearances for sunroof operation and glass lid alignment.
- Handle glass lid with care to prevent damage.
- Fully close the glass lid before removal, then do not operate sunroof motor assembly after removal.
- When removing sunroof unit assembly, use shop cloths to protect the seats and trim from damage.
 Always work with a helper.

NOTE:

For easy installation, mark each point before removal.

J

Κ

L

Μ


Ν

0

Ρ

Н

SEC. 736

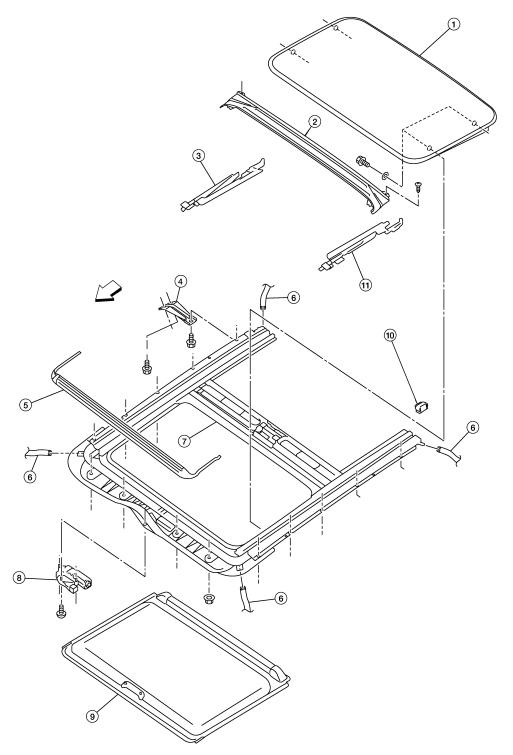

- 1. Glass lid
- 4. Sunroof bracket
- Sunroof unit assembly
 Sunshade stopper
- Rear drain assembly
 Wind deflector

 - 8. Sunroof motor assembly
 - 11. Link assembly (LH)

- WIIA1243E
- 3. Link assembly (RH)
- 6. Drain hose
- 9. Sunshade
- $\leftarrow \quad \text{Vehicle front}$

SUNROOF UNIT ASSEMBLY


< ON-VEHICLE REPAIR >

Removal


- 1. Tilt glass lid up, then remove. Refer to <u>RF-21, "Removal and Installation"</u>.
- 2. Position sunroof unit assembly to the fully closed position.
- 3. Remove the headlining. Refer to El-45. "Component".
- Disconnect drain hoses.
- 5. Remove the screws, then disconnect the sunroof motor assembly.

NOTE:

- · Before removing sunroof motor assembly, make sure that sunroof is fully closed.
- · After removing sunroof motor assembly, do not attempt to rotate sunroof motor as a single unit.

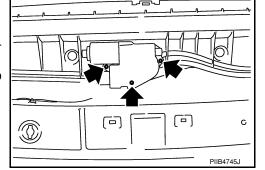


6. Remove the side and front sunroof unit assembly nuts.

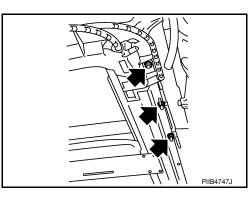

- 7. Remove sunroof bracket bolts, then remove sunroof unit assembly from roof panel.
 - · Remove sunroof unit assembly through the passenger compartment.


CAUTION:


Use care during assembly removal and installation to avoid damage to seats and trim.

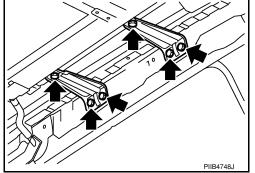




- 1. Install sunroof brackets and bolts to the roof panel side only, but do not tighten.
- 2. Bring sunroof unit assembly into passenger compartment and position it so the rear rests on the sunroof brackets.
- 3. Install sunroof bracket bolts to the sunroof unit assembly side, but do not tighten.

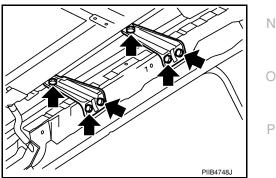

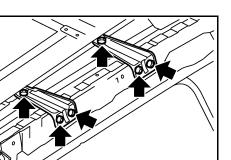

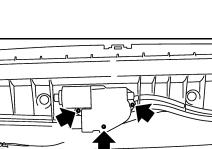

F

Н

RF

Κ

L

Μ

А


В

D


Ε

< ON-VEHICLE REPAIR >

4. Install the front and side sunroof unit assembly nuts, but do not tighten.

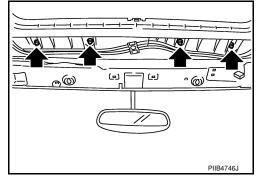

- 5. Tighten the sunroof unit assembly.
- a. First, tighten the sunroof bracket bolts at the vehicle side, then tighten the bolt on the rail side.
- b. Next, tighten the front and side sunroof unit assembly nuts diagonally.
- PIBE745J
- 7. Connect the sunroof motor assembly connector and install the screws.

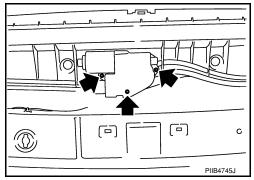


- 8. Install the glass lid. Refer to "GLASS LID" .
- 9. Connect drain hoses.
- 10. Install headlining. Refer to EI-45, "Component".
- 11. Perform fitting adjustment and test for leaks, refer to RF-26, "Fitting Adjustment" .

GLASS LID

Removal

- 1. Open the sunshade fully and close the glass lid.
- 2. Remove glass lid bolts, then remove glass lid.

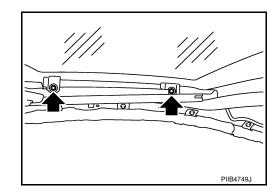


< ON-VEHICLE REPAIR >

- 1. Position the glass lid on sunroof unit assembly.
- 2. Partially install glass lid bolts. Tighten left front bolt first, then right rear to prevent uneven torque while А tightening remaining bolts.
- 3. After installation, check sunroof operation and glass lid assembly alignment. Refer to RF-26, "Fitting Adjustment".

SUNSHADE

Removal

- 1. Remove the headlining. Refer to EI-45, "Component".
- 2. Remove sunshade stopper RH/LH.
- 3. Pull sunshade out rear of sunroof frame to remove it from sunroof unit assembly frame.

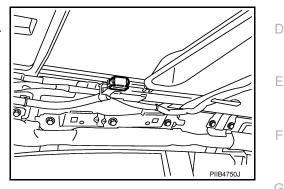


Installation Installation is in the reverse order of removal.

WIND DEFLECTOR

Removal

- 1. Open the glass lid.
- 2. Remove spring retainer screws RH/LH, then slide retainer forward in vehicle out of sunroof unit assembly channel.
- 3. Lift wind deflector and rotate arms upward to release from sunroof unit assembly.

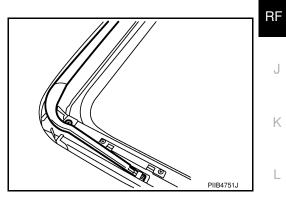


Installation Installation is in the reverse order of removal.

SUNROOF MOTOR ASSEMBLY

Removal

- 1. Close the glass lid.
- Remove headlining. Refer to <u>EI-45, "Component"</u>.
- Remove sunroof motor assembly screws.
- Disconnect harness connector from sunroof motor assembly, 4. then remove sunroof motor assembly. **CAUTION:**
 - · When removing the sunroof motor assembly, be sure that the sunroof lid is in the fully closed position.
 - Do not operate the removed sunroof motor assembly as a single unit.

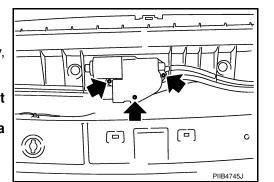

В

Н

Μ

Ν

< ON-VEHICLE REPAIR >

CAUTION:

- Before installing the sunroof motor assembly, be sure the link assembly is in the symmetrical and fully closed position.
- Align the link notch with the hole of the guide track (fully closed: RH and LH).
- 1. Place the sunroof motor assembly flat onto the sunroof unit assembly surface.
- 2. Laterally move the assembly little by little so that the gear is completely engaged into the wire and there is no gap between the sunroof unit assembly and sunroof motor assembly.
- 3. Install the sunroof motor assembly screws, then connect the harness connector.
- 4. After installing, perform the initialization procedure. Refer to <u>RF-10, "System Description"</u>.

LINK ASSEMBLY


Removal

- 1. Remove sunroof unit assembly. Refer to <u>RF-21, "Removal and Installation"</u>.
- 2. Remove screws, then remove rear drain assembly.
- 3. Remove sunroof motor assembly. Refer to RF-21, "Removal and Installation".
- 4. Remove link assembly from the rear end of the sunroof frame.

Installation

Installation is in the reverse order of removal.

Fitting Adjustment

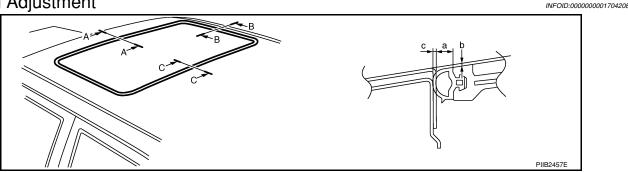

	a	b	C
A-A	5.8 mm (0.228 in)	0.75 \pm 1.5 mm (0.03 \pm 0.059 in)	1.4 \pm 0.8 mm (0.055 \pm 0.031 in)
B–B	5.8mm (0.228 in)	0.75 \pm 1.5 mm (0.03 \pm 0.059 in)	1.4 \pm 0.8 mm (0.055 \pm 0.031 in)
C–C	5.8mm (0.228 in)	0.75 \pm 1.5 mm (0.03 \pm 0.059 in)	1.4 \pm 0.8 mm (0.055 \pm 0.031 in)


GAP ADJUSTMENT

- 1. Tilt up glass lid.
- 2. Loosen glass lid bolts, then tilt down glass lid.
- Adjust glass lid from outside of vehicle so it resembles "A–A" "B-B" "C–C" as shown in the figure.
 - For gap adjustment "A-A" "C-C", carefully slide glass lid forward and rearward in vehicle.
 - For gap adjustment "B-B", loosen sunroof unit assembly and shift side to side.

NOTE:

To prevent glass lid from moving after adjustment, lightly tighten the bolts.

- 4. Tighten left front bolt, then right rear bolt to prevent uneven torque. Tighten remaining bolts, being careful to prevent glass lid from moving.
- 5. Tilt glass lid up and down several times to check that it moves smoothly, and retains the adjustment.

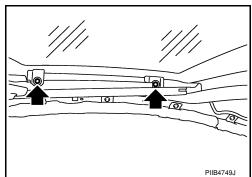


< ON-VEHICLE REPAIR >

HEIGHT ADJUSTMENT

- 1. Tilt up glass lid.
- 2. Loosen glass lid bolts, then tilt down glass lid.
- 3. Adjust glass lid from outside of vehicle so it resembles "A-A" "B-B" "C-C" as shown in the figure.
 - For height adjustment, manually raise/lower glass lid assembly until height difference is within specifications.

NOTE:


- If necessary, shims may be added between sunroof unit assembly and roof panel to increase glass lid height adjustment range.
- To prevent glass lid from moving after adjustment, lightly tighten the bolts.
- 4. Tighten left front bolt, then right rear bolt to prevent uneven torque. Tighten remaining bolts, being careful to prevent glass lid from moving.
- 5. Tilt glass lid up and down several times to check that it moves smoothly, and retains the adjustment.

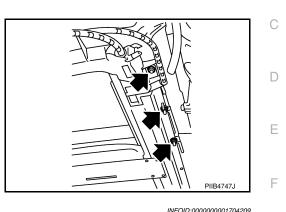

Inspection

WIND DEFLECTOR

Check that the wind deflector (1) moves freely within the sunroof unit assembly while manually pressing down and releasing. If a malfunction is detected, remove and visually check the deflector for damage, deteriorated components, or foreign objects within mechanism. Check to determine if a sufficient amount of grease has been applied to the pivot areas for non-binding operation, if not add grease as required. If it is damaged, replace it with a new one. If no damage is found, reinstall it properly. \Leftarrow : Vehicle front

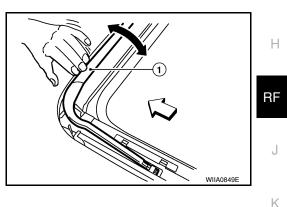

LINK ASSEMBLY AND WIRE

NOTE:

Before replacing a suspect part, make sure it is the source of noise being experienced.

- 1. Check link to determine if coated film has peeled off to such an extent that substrate is visible. Check also to determine if link is the source of noise. If it is, replace it.
- 2. Visually check to determine if a sufficient amount of grease has been applied to wire or rail groove of the sunroof unit assembly. If not, add grease as required.
- 3. Check wire for any damage or deterioration. If any damage is found, replace sunroof unit assembly.

WEATHERSTRIP

- 1. Visually check weatherstrip for damage, deterioration, or deformation.
 - Open glass lid assembly enough to inspect front edge of weatherstrip.
 - Tilt up glass lid assembly fully to inspect sides and rear edge of weatherstrip.

If any area of the weatherstrip is found to be damaged, replace the glass lid assembly. Refer to <u>RF-21.</u> (<u>"Removal and Installation"</u>.

- 2. Check for leakage around glass lid.
 - · Close glass lid fully.
 - Pour water around surface to determine area of concern.
 - For gaps or misalignment, adjust glass lid to specifications. Refer to RF-26. "Fitting Adjustment" .
 - For damaged sealing surfaces, either replace glass lid <u>RF-21, "Removal and Installation"</u>, or repair the panel <u>BL-265, "Precaution in Repairing High Strength Steel"</u>.

DRAIN HOSES

А

Μ


Ν

< ON-VEHICLE REPAIR >

1.

4.

Hatchback Models

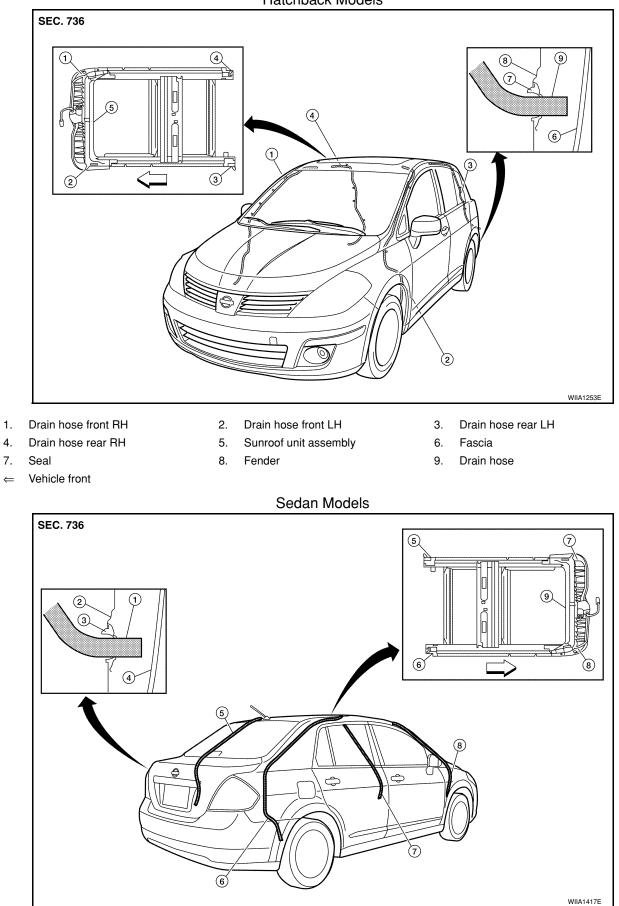

< ON-VEHICLE REPAIR >

	1.	Drain hose	2.	Fender	3.	Seal	А
	4.	Fascia	5.	Drain hose rear LH	6.	Drain hose rear RH	
	7.	Drain hose front LH	8.	Drain hose front RH	9.	Sunroof unit assembly	
1		Vehicle front emove headlining. Refer to <u>El-</u>	<u>45. "</u>	Component".			В
2	•	isually check drain hoses for: Proper connection at sunroof u Damage, pinch, cracks, deteric Proper fastening and routing o	oratio	on.			С
З If	. P	our water through drain hoses t maged or leaking portion in an	o de	etermine watertight performanc		ain hose as an assembly.	D
							E
							F

Н

G

RF

J

Κ

Μ

Ν

0